



Technical Service Bulletin

No.LA419-003
11 October 2005

Subject/Concern: Discovery 3/LR3 - Accessory Phone System Fault

Models:
Discovery 3 / LR3

Markets: All
Section: 419-08

Summary:
A customer may report a concern that when the ignition is switched on or off, the navigation system voice announces 'sorry' or 'command not recognized'.
Cause: This is a component software error from the phone system manufacturer.
Action: On a customer complaint basis only regarding the above, refer to the Service Procedure detailed in this bulletin to renew the telephone module.

Parts Required:		
Description	Part Number	Quantity
Accessory phone module	XVD500021	1


Labour Time:		
Operation Description	Operation No.	Time
Renew phone module	86.53.89/31	0.10 hours

Repair/Claim Coding:	
Causal Part:	XVD500020
ACES Condition Code:	42
Defect Code:	

Service Instruction

The renewal of this module may also remedy the following faults:

1. It will stop the present call being terminated when another call attempts to connect (call waiting).
2. When a call is ended the phone will not stay muted (currently requiring an ignition cycle to rectify the problem).
3. The red button will now cancel an unanswered call.
 - 1 . Release the cellular telephone module from the Velcro® retaining strips.

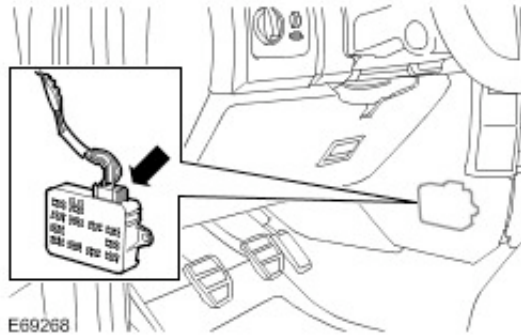

- 2 . Remove the cellular telephone module from behind the floor console. Refer to illustration in step 1.
- 3 . Disconnect the cellular telephone module electrical connector. Refer to illustration in step 1.
- 4 . Remove the cellular telephone module.
- 5 . Attach Velcro® strips to the new cellular telephone module.
- 6 . Position the cellular telephone module from behind the floor console.
- 7 . Attach the cellular telephone module to the Velcro® retaining strips.

©2005 LandRover