

TECHNICAL BULLETIN

No: LTB00296 (ISSUE 1)
18 FEB 2011

RANGE ROVER



CIRCULATE TO: SERVICE PARTS WARRANTY BODY SHOP
 ✓ ✓ ✓ ✓

SECTION: 501

Upper Glove Compartment Rattle

AFFECTED VEHICLE RANGE:

LR3 (LA)

VIN: 5A000360 - 9A513325

Model Year: 2005 - 2009

Range Rover Sport (LS)

VIN: 6A900290 - 7A999999

7A100000 - Onwards

Model Year: 2006 - Onwards

CONDITION SUMMARY:

Situation: The upper glove compartment may exhibit a rattle. This may be caused by the upper glove compartment lid bump stop(s) being worn.

Action: In the event of a customer concern of the above, refer to the Repair Procedure outlined below to install new upper glove compartment bump stops.

PARTS:

LR020472Rubber bump stop

Qty: 2

TOOLS:

Refer to Workshop Manual for any required special tools

WARRANTY:



NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Upper glove compartment lid bump stop - Install	05.10.01	0.10	42	FWT500013

Normal Warranty policies and procedures apply.

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

REPAIR PROCEDURE

INSTALL UPPER GLOVE COMPARTMENT LID BUMP STOPS

1. Open the upper glove compartment lid
2. Remove the existing right-hand (RH) bump stop from the compartment liner. (Figure 1)



CAUTION: Do not damage surrounding area.

3. Using a small screwdriver, carefully install the new bump stop. (Figure 2)
4. Twist / pull the bump stop lightly, ensuring it is fully seated. (Figure 3)
5. Repeat steps 2 - 4 on the left-hand (LH) bump stop.

Figure 1

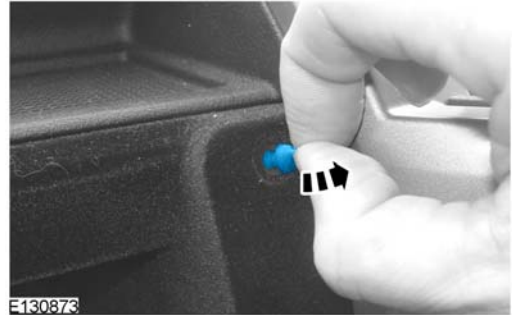


Figure 2

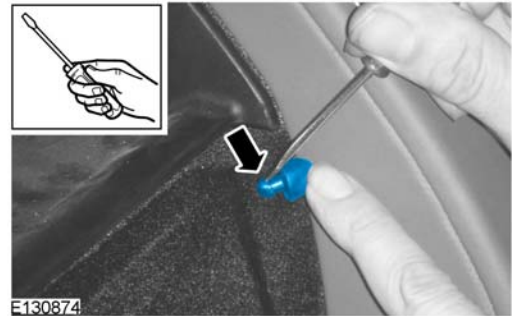


Figure 3

