

[Click here to print](#)


Connector: **C0391**

CONNECTOR HOUSING NOT SERVICEABLE

Description: **Chassis harness to main harness**

Location: **Below LH rear wheelarch**

Qualifier:

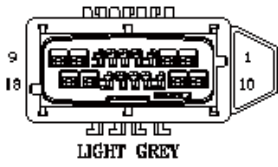


Part No.: **YPC909640**

Colour: **LIGHT GREY**

Cavities: **18WY**

Harness: **CHASSIS HARNESS**

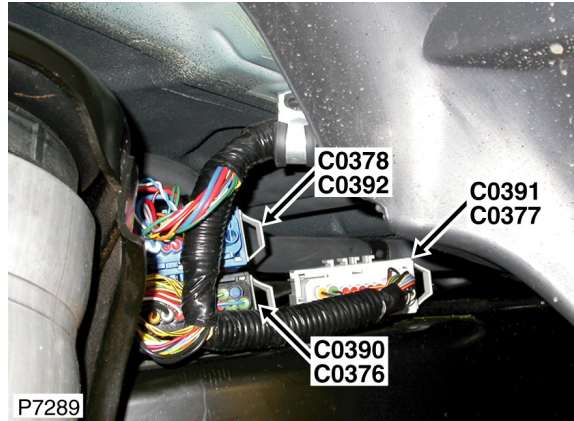

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Applicator	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0D	BY	419	C2101	-	-	-	-	-	-	-
2	1.0D	BG	419	C2101	-	-	-	-	-	-	-
7	1.0D	BW	419	C2101	-	-	-	-	-	-	-
8	1.0D	BU	419	C2101	-	-	-	-	-	-	-
9	1.0D	BP	419	C2101	-	-	-	-	-	-	-
10	1.0D	BO	419	C2101	-	-	-	-	-	-	-
11	0.5D	BO	419	C0781	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
12	0.5D	OY	419	C1699	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.5D	OR	419	C1699	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5D	OB	419	C1699	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.5D	SY	419	C1698	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.5D	SU	419	C1698	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
17	0.5D	SR	419	C1698	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
18	0.5D	BN	419	C0781	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Connector: **C0391**

CONNECTOR HOUSING NOT SERVICEABLE

Description: **Chassis harness to main harness**

Location: **Below LH rear wheelarch**